



2820 S. English Station Road - Louisville, KY 40299

TEST NO. 19-095-1

Test Report - ISO 5011 Performance Testing

7.0 Test Procedure for dry-type air cleaners - Industrial Applications

page 1 of 3

1. Test Unit

Manufacturer: Premium Filter SAS
 Part Number / Identifier: PFI-25-24RAC Brasil
 Pre-Cleaner: N/A
 Primary Element: Outer Dia. 330.2 mm X Inner Dia. 177.8 mm X Height 381 mm
 Secondary Element: N/A
 Dust Cap Unloader Valve
 Tubular Inlet Non-Tubular Inlet Cylindrical Air Filter
 Outlet: 6.25"

2. Test Conditions

Test Dust: ISO Course A-4 Dust Batch Number: 12827C 30 Oct 2015
 Pre Barometer (" Hg): 29.34 Post Barometer ("Hg): 29.42
 Pre Temperature: (°F): 74.5 Post Temperature (°F): 75.2
 Pre-Test Humidity (%): 31.3 Post Test Humidity (%): 41.7
 Applied Method Direct Weighing Method Absolute Filter Method
 Rated Air Flow (CFM): _____
 Test Air Flow (CFM): 1000 Steady Variable
 Test Terminal Condition: 23.1" WG (5.75 kPa)
 Dust Feeder Type: ISO 5011 Injector
 Dust Concentration (g/ft³): 1.0 g/m³
 Number of dust injectors: 1

3. Test Results

Restriction (at test air flow): 3.12 " WG
 Differential Pressure: 3.12 " WG
 Pressure Loss: 0 " WG
 Initial Efficiency: 99.51 %
 Full-Life Efficiency: 99.79 %
 Pre-Cleaner Efficiency: NA %
 Capacity: 4,054.6 g DHC at 23.1 "WG grams

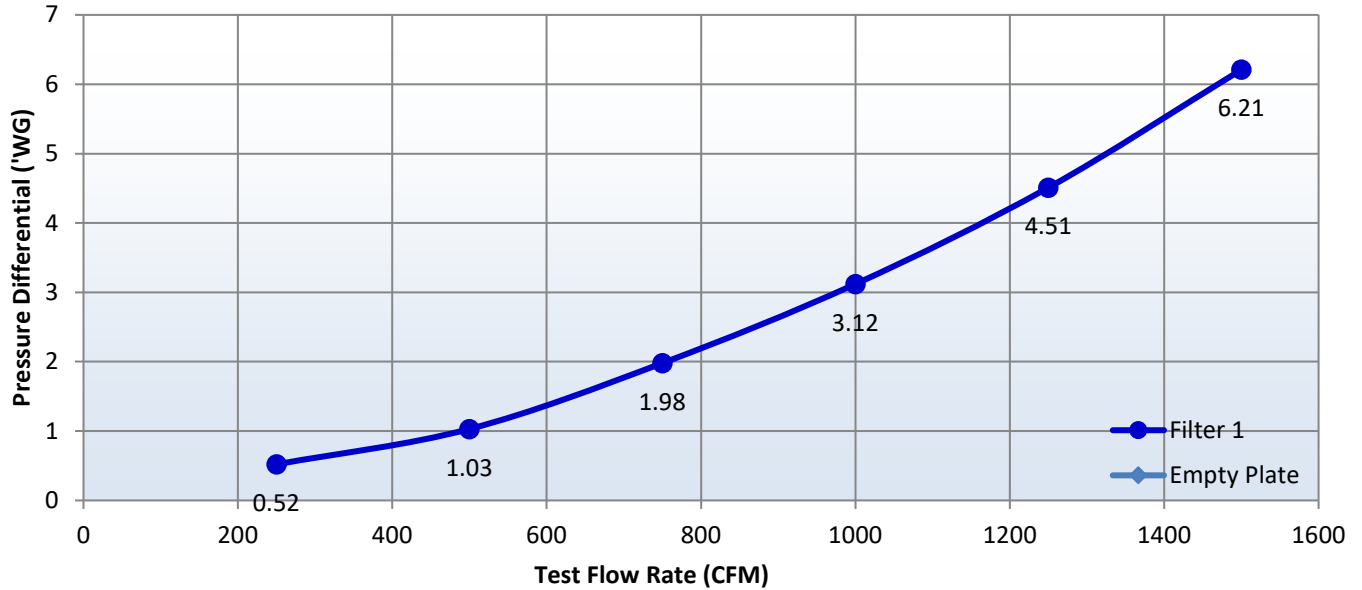
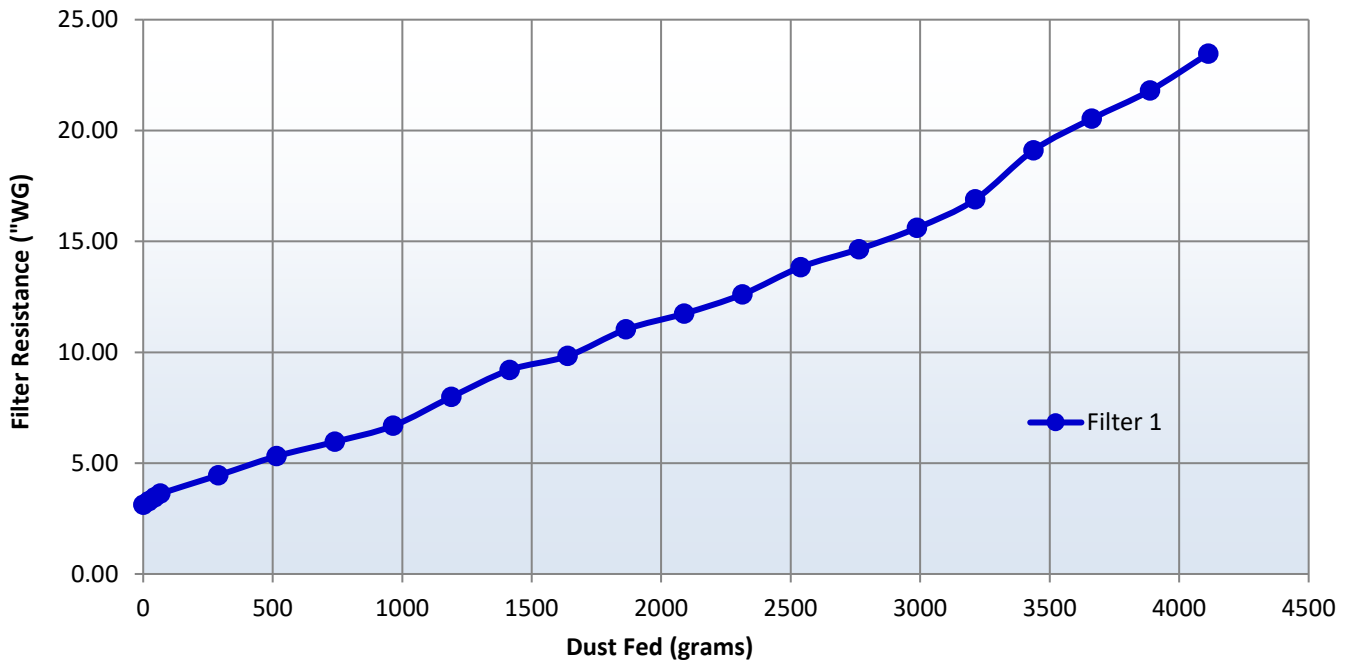
4. Comments

Requestor Information

Test Requestor Harvey Alexander Pulido Phone Number 571-421-1077
 Company Name Premium Filters SAS Email: rencia@premiumfilters.com
 Company Address Autop Norte KM 36, TOC, CUND, COLC Date Requested 2/25/2019

Test Operator Information

Test Performed by: Tyler Shoulders CAFS Completion Date 3/12/2019

Air Cleaner Restriction / Differential Pressure vs. Flow Rate

Dust Fed vs. Resistance


Requestor Information

 Test Requestor Harvey Alexander Pulido

 Phone Number 571-421-1077

 Company Name Premium Filters SAS

 Email: renca@premiumfilters.com

 Company Address Autop Norte KM 36, TOC, CUND, COL

 Date Requested 2/25/2019

Test Operator Information

 Test Performed by: Tyler Shoulders CAFS

 Completion Date 3/12/2019

Test Report - ISO 5011 Performance Testing

7.0 Test Procedure for dry-type air cleaners - Industrial Applications

page 3 of 3

Pre Test Photo - Front



Post Test Photo - Detail



Requestor Information	Test Requestor <u>Harvey Alexander Pulido</u>	Phone Number <u>571-421-1077</u>
	Company Name <u>Harvey Alexander Pulido</u>	Email: <u>rencia@premiumfilters.com</u>
Test Operator Information	Company Address <u>Autop Norte KM 36, TOC, CUND, COLC</u>	Date Requested <u>2/25/2019</u>
	Test Performed by: <u>Tyler Shoulders CAFS</u>	Completion Date <u>3/12/2019</u>